
REVISED 5-7-TIN TT Cable H 11.34 FMEA NO. SHUTTLE CCTV ONG NO. 2293995-502 CRITICAL ITEMS LIST [S5UED 10-14-86 CRITICALITY 2/1R SHEEF FATEURE MUDE AND FÄILURE EFFECT CAUSE RATIONALE FOR ACCEPTANCE ON END ITEM oss of location Code RTN 1) No PTU control DESIGN FEATURES 2) No video The Will RVS/PTU cable is a 15-fach long assembly, 16-wire assembly. The cable is pen terminated on each end with a 37-pin connector (PI, KJ66E14M35SM16). The video and sync wires are shielded #24 Twinax twisted-pair wires. The WII cable provides power and Worst Case: commands from the remote video switch (RVS) to the RMS elbow comera stack and returns No PTU control of elbow camera which prevents video signals to the RYS. arm stowage. The cable design is taken from the successfully flown Apollo program. The design is a cable-connector assembly in which the wire Lerminations are protected from excessive flexture at the joint between the wire and the connector terminal. The load concentration is moved away from the conductor connection and distributed axially along the length of the conductors encapsulated in a potted-taper profile. This technique also protects the assembly from dirt and entrapped moisture which could gause problems in space. The cable and its components meet the applicable requirements of NASA, Military and RCA specifications. These requirements include: General/Mechanical/Électrical Features Design and Construction Materials Terminal Solderability Environmental Qualification Marking and Serialization Traceability and Documentation

CON-1174

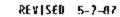

FMEA NOT. W 11.34 CRITICALITY 2/1R		SHUTTLE ČCTV CRITICAL TTEMS LIST	UNIT Cable DUG NO. 2293995-502 ISSUED TO-TA-BE SHEET 2 DE 5
FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	RATIONALE FOR ACCEPTANCE	
s of location Code RTM	li No PIU control 2) No video Worst Case: No PIU control of elbow camera which prevents arm stowage.	Qualified by 1.) similarity to previous successful squalification tests of CCTV tRUs. ACCEPTANCE TEST The cable acceptance test consists of an ohmneter ch connection is present and intact. Results are record operational TEST The following tests verify that CCTV components are the PHS (A7A1) panel switch, through the RCU, through to the Camera/PTU command decoder are proper. The tability to produce video, the VSB's ability to route display video. A similar test verifies the MDM common Pre-Launch on Orbiter Test/In-Flight Test 1. Power CCTV System. 2. Select a monitor via the PHS panel, as destinate source. 3. Send "Camera Power On" command from PHS panel. 4. Select "External Sync" on monitor. 5. Observe video displayed on monitor. If video of stable rasters, then this indicates that the camera from the RCU and that the camera is producing select Bownlink as destination and camera under monitor or direct observation) verify proper op 7. Select Bownlink as destination and camera under 8. Observe video routed to downlink. 9. Send "Camera Power Off" command via PHS panel. 10. Repeat Steps 3 through 9 except issue commands proves that the CCTV equipment is operational in the CCTV equipment is operational in the command of the CCTV equipment is operational in the cCTV equipment in the cCTV equipment is operational in the cCTV equipment in the cCTV equipment in	pace programs and 2.) by use during eck to assure that each wire ded on data sheets. operable and that the commands from h the sync lines to the Camera/PTH, ests also verify the camera's video and the oxinitor's ability to and path. lon and the camera under test as n monitor is synchronized {i.e., mera is receiving composite sync ynchronized video. ands and visually {either via the eration. test as source.

		45472En 2-1-81	
FMEA NO. W 11.34 CRITICALITY Z/IR FAILURE MODE AND CAUSE	FARLURE EFFECT ON END ITEM	SHUTTLE CCTV CRITICAL ITEMS LIST RATIONALE FOR ACCEP	UNTT Cable BMG NOT 2293995-502 LSSUED TO-14-B6 SHEET 3 OF 5
s of location Code NTN	1) No PTU control 2) No video Worst Case: No PTU control of elbow camera which prevents arm stowage.	Produrement Control - Wire, connectors, solder, et and suppliers which meet the requirements set fort Plan Work Statement (WS-2593176). Incoming Inspection & Storage - Incoming Quality i materials and parts. Results are recorded by lot control numbers for future reference and traceabil Material Controlled Stores and retained under spec fabrication is required. Mon-conforming materials (MRB) disposition. (PAI-307, PAI IQC-53). Assembly & Test - Prior to the start of assembly, by stuck room personnel as the items are accumulativerified again by the operator who assembles the kas-built-parts-list (ABPL). Instructions are given in assembly drawing notes a 2280800 - Process Standard crimping flight connect Standard in-line splicing of standard interconnect 2280876 - Process Standard marking of parts or ass Potting material and test procedure (TP-AI-2293287 performed at the completion of key operations. Preparation for Shipmant - When fabrication and te packaged according to 2280746, Process Standard fo All related documentation including assembly drawi is gathered and held in a documentation folder ass assembly. This folder is retained for reference.	c. are procured from approved vendors h in the CCIV contract and Quality is inspections are made on all received and retained in file by drawing and ity. Accepted items are delivered to iffed conditions until cable are held for Material Review Hoard all items are verified to be corrected to form a kit. The items are it by checking against the ity checking against the on contacts, 2280801 - Processing wire using Raychem solder sleeves, emblies with epoxy colors, 2200876. Applicable documents is the cable assembly is reackaging and Handling Guidelines. Ands. Parts List, ABPL, Test Data, etc.

REVISED 5-7-87

FNEA NO. W 11.34 CRETICALITY 2/)R		SHUTTLE CCTV CRETICAL ITEMS LIST	UNIT Cable DWG NO. 2293995-502 1SSUED 10-14-86 SHEET 4 0F 5	
FATLURE MODE AND CAUSE	FAILURE EFFECT ON END ETEN 1) No PTU control 2) No video Murst Case: No PTU control of elbow camera which prevents arm stowage.	RATEONALE FOR ACCEPTANCE		
ss of location Code RTM		FAILURE HISTORY There have been no reported failures during RCA tes		

REVISED 5-7-87

FMEA NO. <u>W 11.34</u> CRITICALITY <u>2/1R</u>		SHUTTLE CCTV CRITICAL ITEMS LIST	DWG NO. 2293995-502 - 15SUED 10-14-86 SHEET 5 OF 5	
FAILURE MUDE AND FAILURE EXPECT CAUSE ON END LIEM		RATIONALE FOR ACCEPTANCE		
iss of location Code RTN	1) No PTU control 2) No video Norst Case: No PTU control of elbow camera which prevents arm stowage.	Loss of ability to position the Elbow camera. Pelbow camera physically interferes with a payloa payload bay door cannot be closed. Loss of creations Perform EVA to reposition the albow camera, use jettison the RMS. CREN TRAINING Crew should be trained to contingency EVA and RMMISSION CONSTRAINT Do not manifest Elbow camera for any flight when Interfere with each other (for any pan or tilt a not change the camera position until the interference.)	d. If RMS cannot be stowed the port and vehicle. RMS notion to reposition the camera, or a special solution of the payload and the elbow camera can angle). If the camera must be flown do	
· :	·		•	